

Plane scanning (CAD)



© 2013 - 2014 Renishaw plc. All rights reserved.

Renishaw® is a registered trademark of Renishaw plc.

This document may not be copied or reproduced in whole or in part, or transferred to any other media or language, by any means, without the prior written permission of Renishaw.

The publication of material within this document does not imply freedom from the patent rights of Renishaw plc.

Disclaimer

Considerable effort has been made to ensure that the contents of this document are free from inaccuracies and omissions. However, Renishaw makes no warranties with respect to the contents of this document and specifically disclaims any implied warranties. Renishaw reserves the right to make changes to this document and to the product described herein without obligation to notify any person of such changes.

Trademarks

All brand names and product names used in this document are trade names, service marks, trademarks, or registered trademarks of their respective owners.

Plane scanning (CAD)

Care of equipment

Renishaw probes and associated systems are precision tools used for obtaining precise measurements and must therefore be treated with care.

Changes to Renishaw products

Renishaw reserves the right to improve, change or modify its hardware or software without incurring any obligations to make changes to Renishaw equipment previously sold.

Warranty

Renishaw plc warrants its equipment for a limited period (as set out in our Standard Terms and Conditions of Sale) provided that it is installed exactly as defined in associated Renishaw documentation.

Prior consent must be obtained from Renishaw if non-Renishaw equipment (e.g. interfaces and/or cabling) is to be used or substituted. Failure to comply with this will invalidate the Renishaw warranty.

Claims under warranty must be made from authorised service centres only, which may be advised by the supplier or distributor.

Trademarks

Windows 98, Windows XP, Windows 2000 and Windows NT are registered tradenames of the Microsoft Corporation.

IBM is the tradename of the International Business Machines Inc

All trademarks and tradenames are acknowledged.

Contents

| | | |
|-----|---|----|
| 1 | Plane scanning (CAD)..... | 6 |
| 1.1 | Tutorial pre-requisites..... | 6 |
| 1.2 | Tutorial objectives..... | 6 |
| 2 | Introduction..... | 7 |
| 3 | Plane scanning using 'Edge Offset' | 8 |
| 4 | Guide point | 9 |
| 5 | Guide rail | 12 |
| 6 | Guide curve | 13 |
| 7 | Tilt and advance | 15 |
| 8 | Create multiple plane scans within one measurement block..... | 17 |
| 9 | Manually define the scan path..... | 18 |
| 10 | Using sweep method | 20 |

1 Plane scanning (CAD)

1.1 Tutorial pre-requisites

- The student should have completed 'Introduction to 5-axis measurement and movement techniques' and 'Boss / bore scanning considering all 5-axis techniques' tutorials

1.2 Tutorial objectives


- Further exposure to 5-axis measurement methods / scan path definition specifically for measuring plane features
- Introduce the principles of 5-axis scanning optimisation

2 Introduction

This tutorial further explains the numerous scanning techniques that can be employed using the REVO system. Particular attention is paid to all parameters involved to maximise speed but maintain metrology integrity and reliability.

3 Plane scanning using 'Edge Offset'

Scanning the top face of the training block:


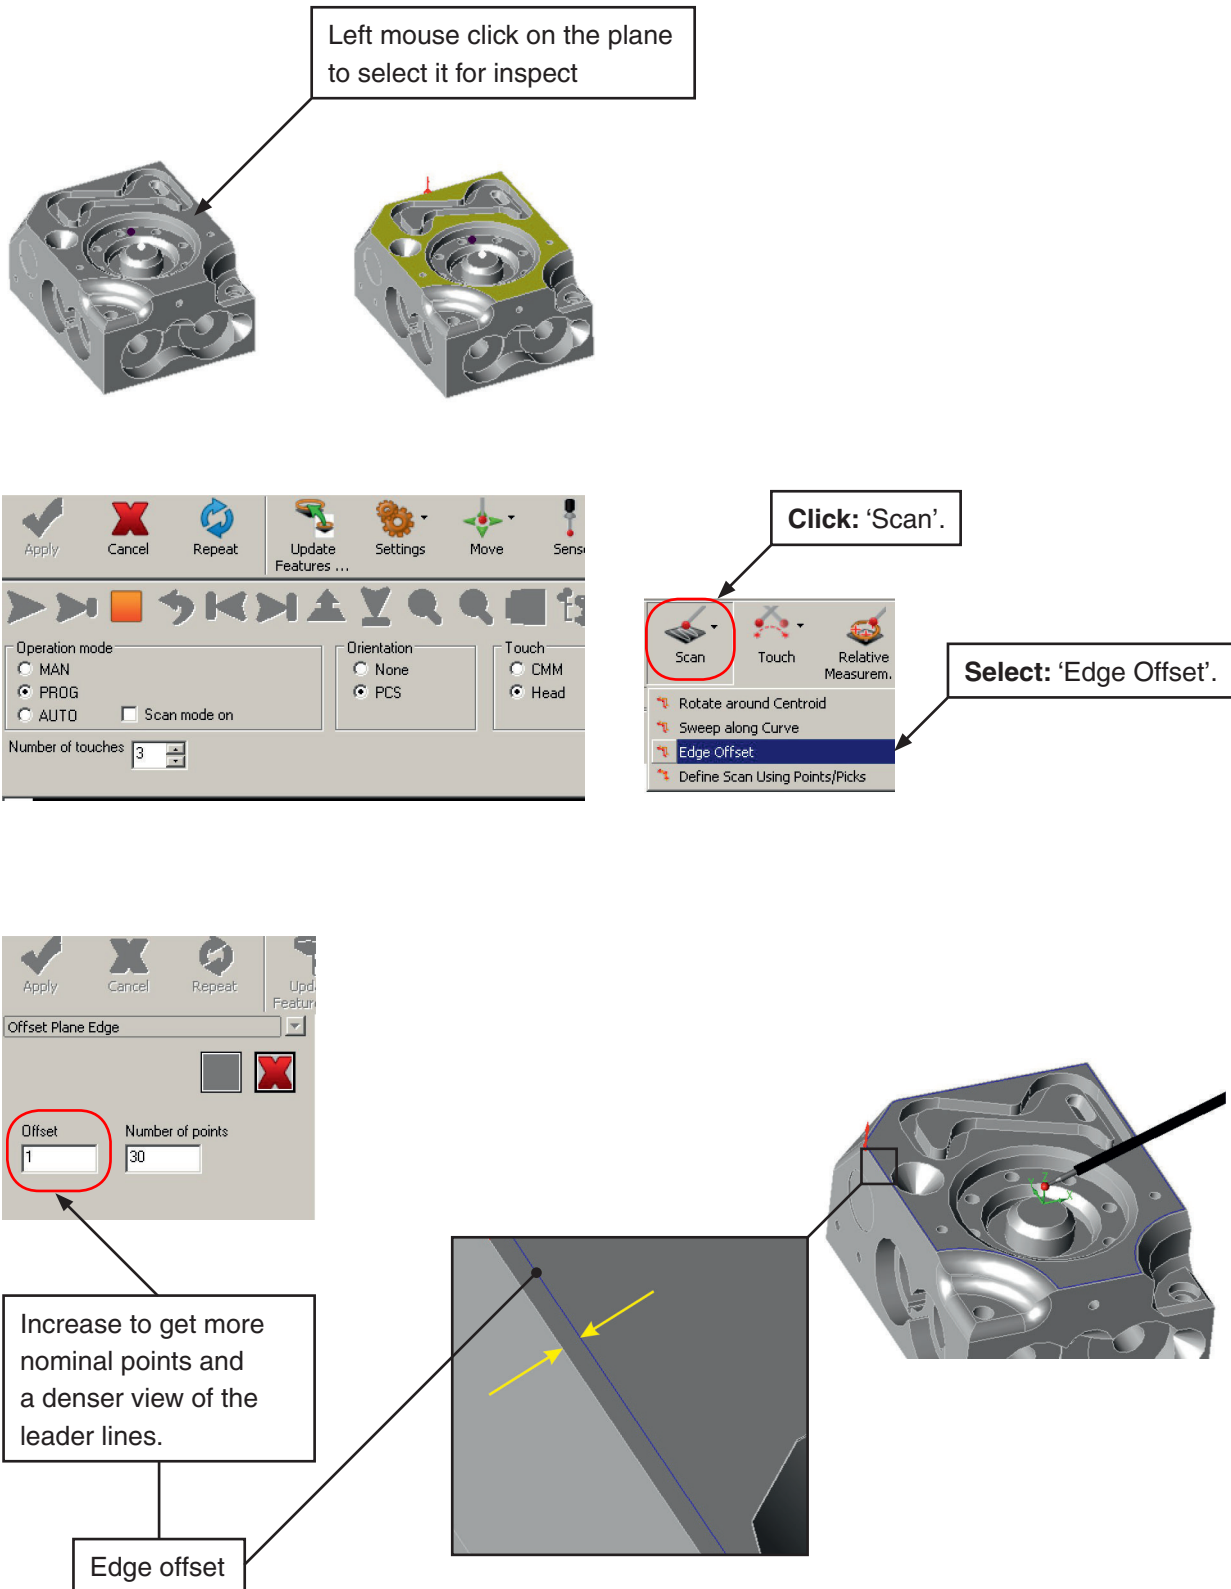


Click one of the plane edges to display the offset. This will allow the green tick to be clicked.

4 'Tilt and Advance' dialogue box - guide point


The 'Tilt and Advance' window is now displayed. This set of options is used to define the head orientation relative to the scan path. The first option to be demonstrated will be the 'Guide Point' method.

The leader lines converge from the inspection path towards a point, which can be dragged in the model window to adjust the orientation of the probe head on scanning or taking touch points.

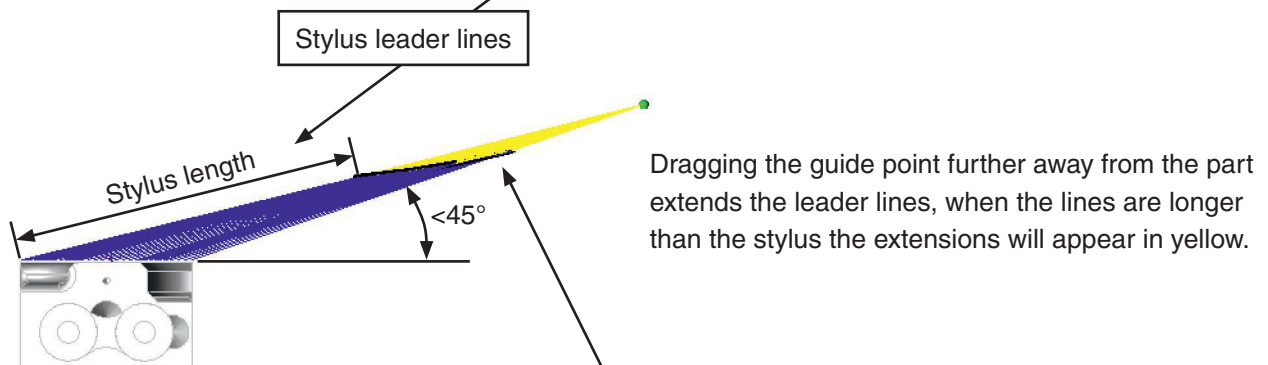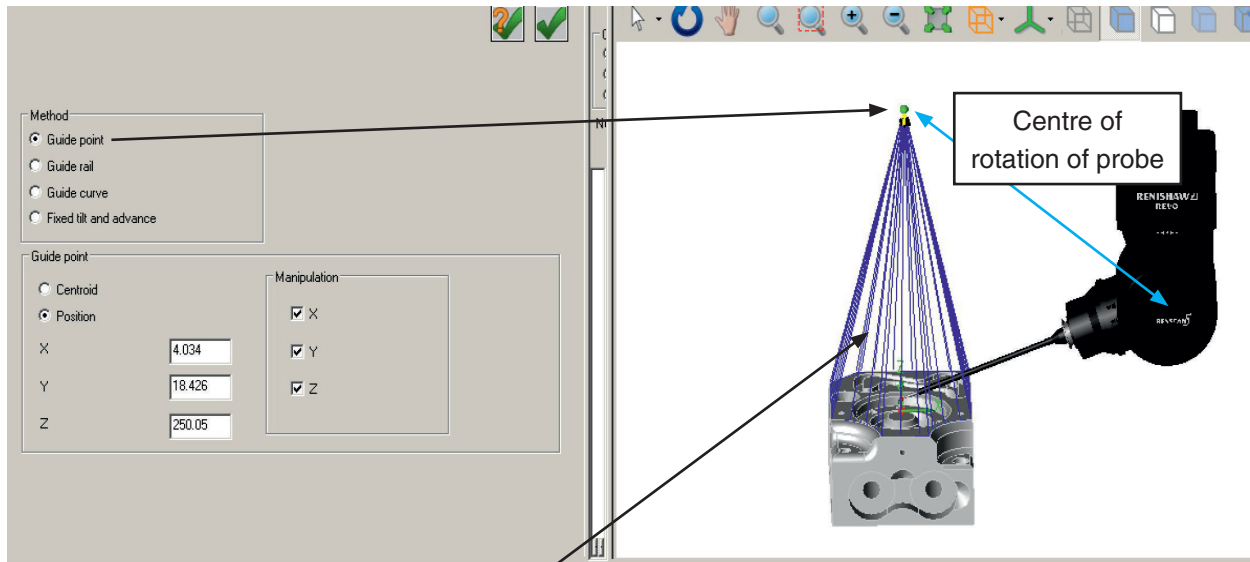

The stylus angle with respect to the feature should be between 0° and 45° for optimum performance.

The black line depicts the movement of the probe head. The smaller the line the more efficient 5 axes moves as the probe is doing most of the work with little CMM movement.

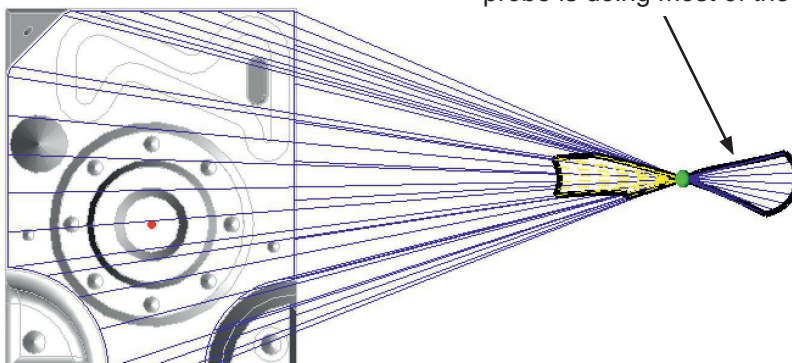

Manipulate point position

Guide point

☐ Centroid
☒ Position

X 224.503
Y 19.588
Z 96.36

Manipulation


☒ X
☐ Y
☐ Z

Restrict any axis. In this case, adjusting the X axis only.

Click: 'Green Tick' to continue.



The probe path will now be drawn on the model:

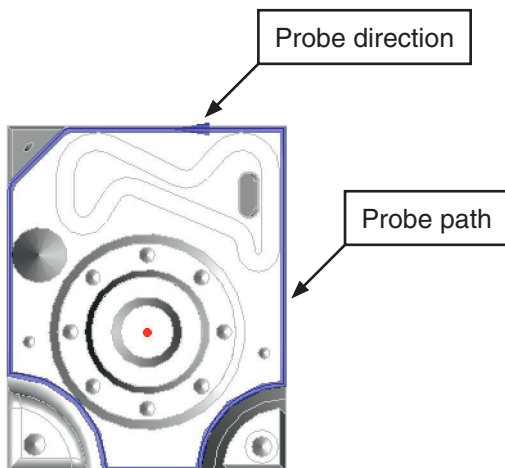

Click: 'Green Tick' to accept.



Code produced:

```
P(PCrv1)=PATH/CURVE,PTDATA,-18.511365,-61.5,0,0,0,1,PCS,nnnnnn
F(PLN001)=FEAT/PLANE,CART,0,0,0,0,0,1
MEAS/PLANE,F(PLN001),3
PAMEAS/DISTANCE,10,SCNVEL,MMPS,30,P(PCrv1),0,0,1
ENDMES
```

To change scanning speed and other parameters double click on the PAMEAS line to bring up the parameter editor.

Measure Path

Path list

| Path | Approach | Sample | Distance | Velocity | Pitch | Re... | Re... | Re... | Re... |
|-------|----------|--------|----------|----------|-------|-------|-------|-------|-------|
| PCrv1 | 0,0,1 | Yes | 10 | MMPS,30 | | | | | |

Delete

Path: PCrv1

☐ No sampling

☒ Sampling distance: 10

☐ Pitch: 0

☒ Scan velocity: 30

☐ Metres per minute
☒ Millimetres per second
☐ Inches per minute
☐ Inches per second

Approach direction:

☐ +X ☐ -X i: 0
☐ +Y ☐ -Y i: 0
☒ +Z ☐ -Z i: 0
☐ Other k: 1
☐ None

Add Modify

Remove:

☐ Distance
☐ Number of points
☒ None

From start From end

OK Cancel

The distance between touch (sample) points on the scan path.

When sweep scanning a surface, the distance between the centre points of sweeps of the scan.

Sweep scanning is covered later in this tutorial.



Increase / decrease the scanning speed.

Click: 'Modify' after making changes then click 'OK'.

The plane is scanned as expected.

5 'Tilt and Advance' dialogue box - guide rail



When using this option, leader lines extend from the inspection path and converge on the guide rail. MODUS calculates a default line to use as a guide rail. The direction and length of the guide rail are defined by the largest extent of the inspection path in the plane in which it lies. The guide rail is offset from the plane of the inspection path by the current probe length.

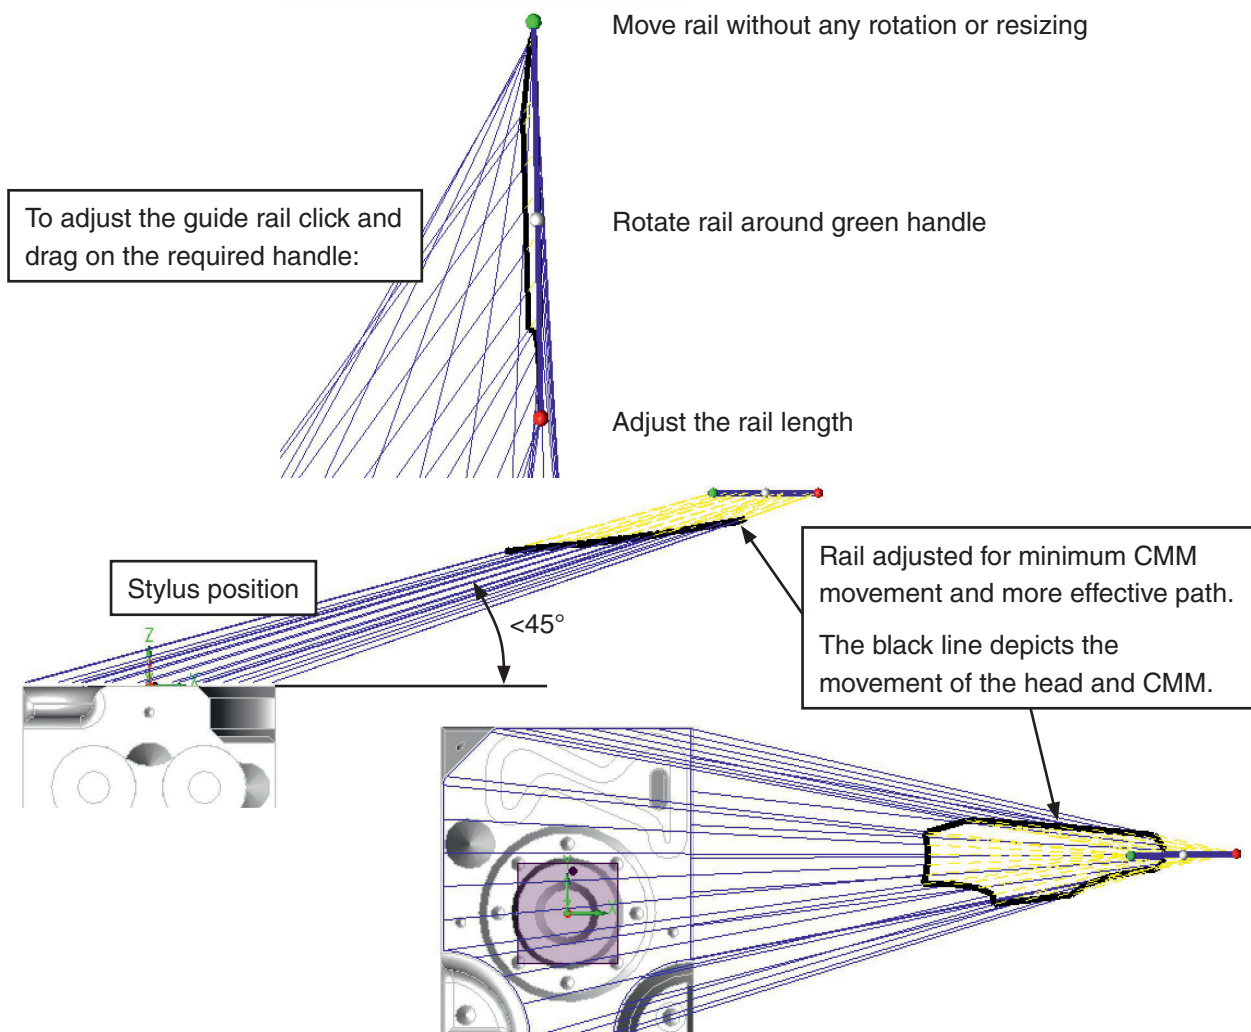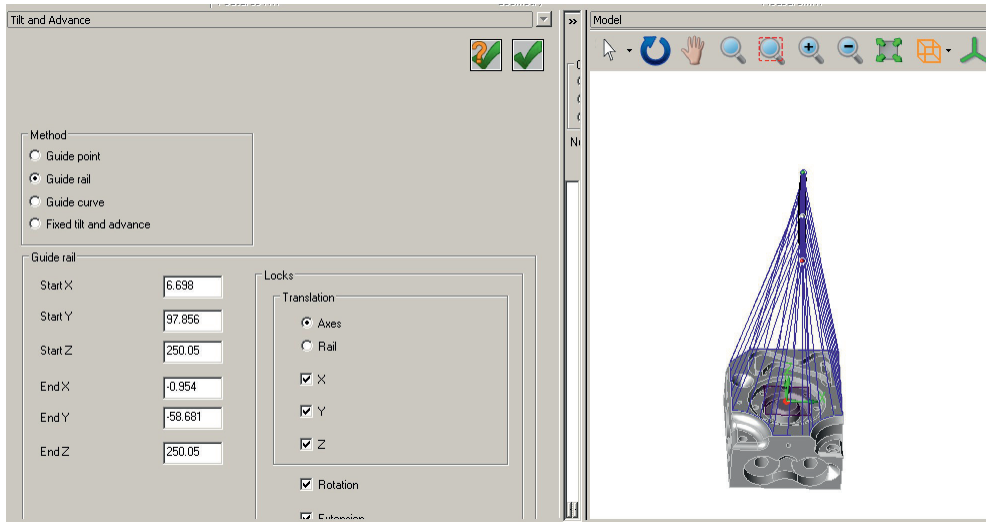


Confirming using the green tick allows the code to be generated.

6 'Tilt and Advance' dialogue box - guide curve


This option projects the inspection path points in space, offsetting each point within the plane of the inspection path by the value in the offset field. The resulting offset curve is then projected along the normal to the plane in which the inspection path lies. MODUS draws a leader line from each point on the inspection path to the equivalent point on the projected offset curve

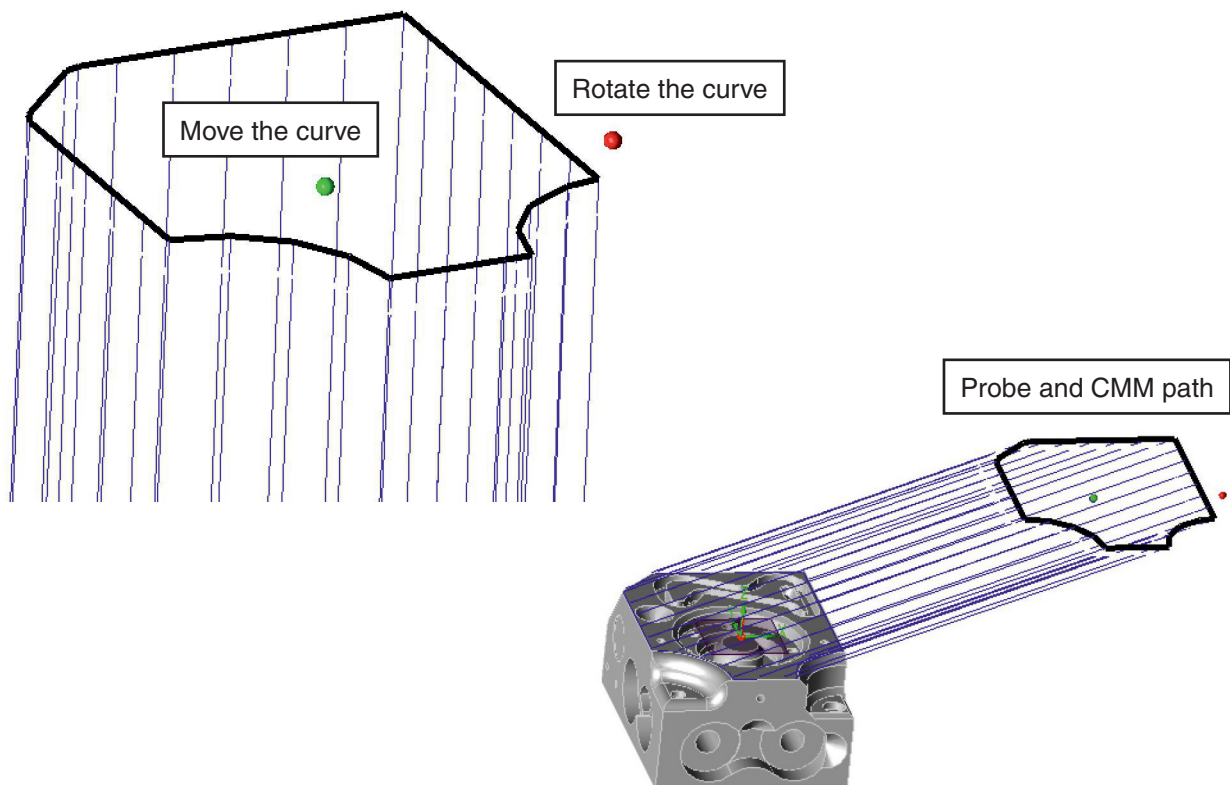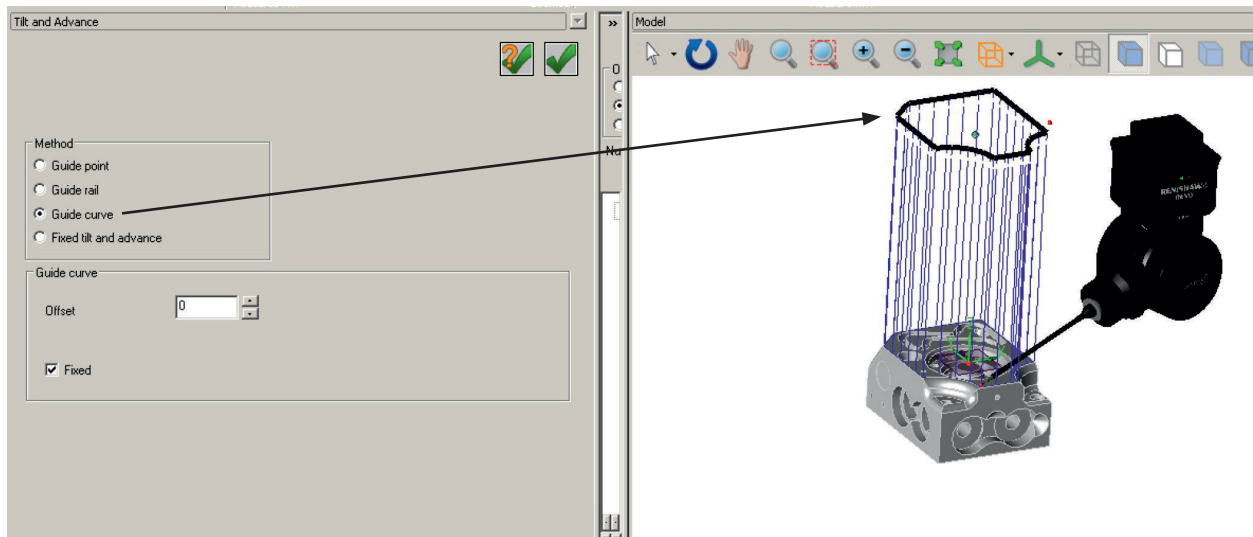

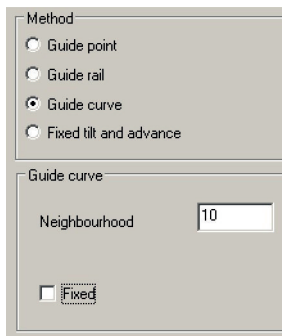


The neighbourhood option allows free-form distortion of the guide curve to adjust the probe motion around obstructions.


Ensure the 'Fixed' box is unchecked on the 'Tilt and Advance' dialogue box. The 'Neighbourhood' field is then displayed. Type in a number to specify how many adjacent points on the guide curve will be moved when one point is dragged to a new position.

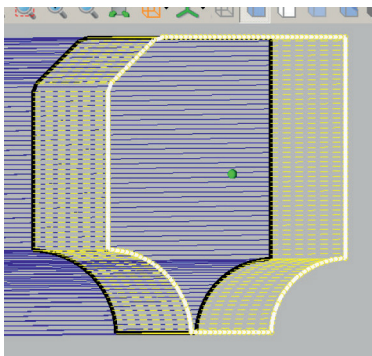

Before

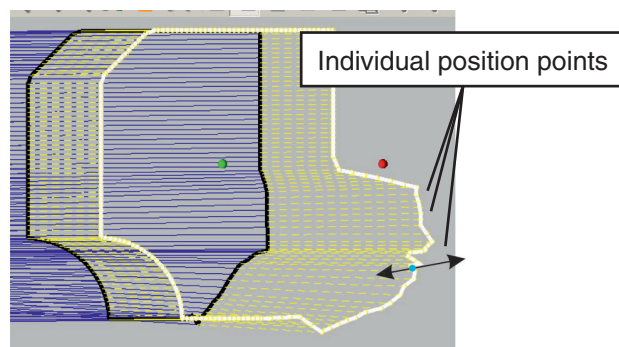


After

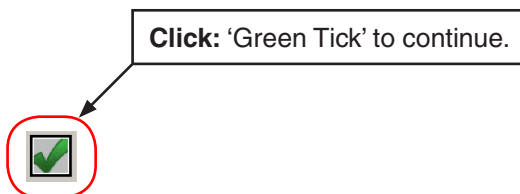




7 'Tilt and Advance' dialogue box - tilt and advance

Again, using the 'Tilt and Advance' dialogue box, select the 'Fixed tilt and advance' option. This is used to maintain the probe orientation relative to the surface during inspection.

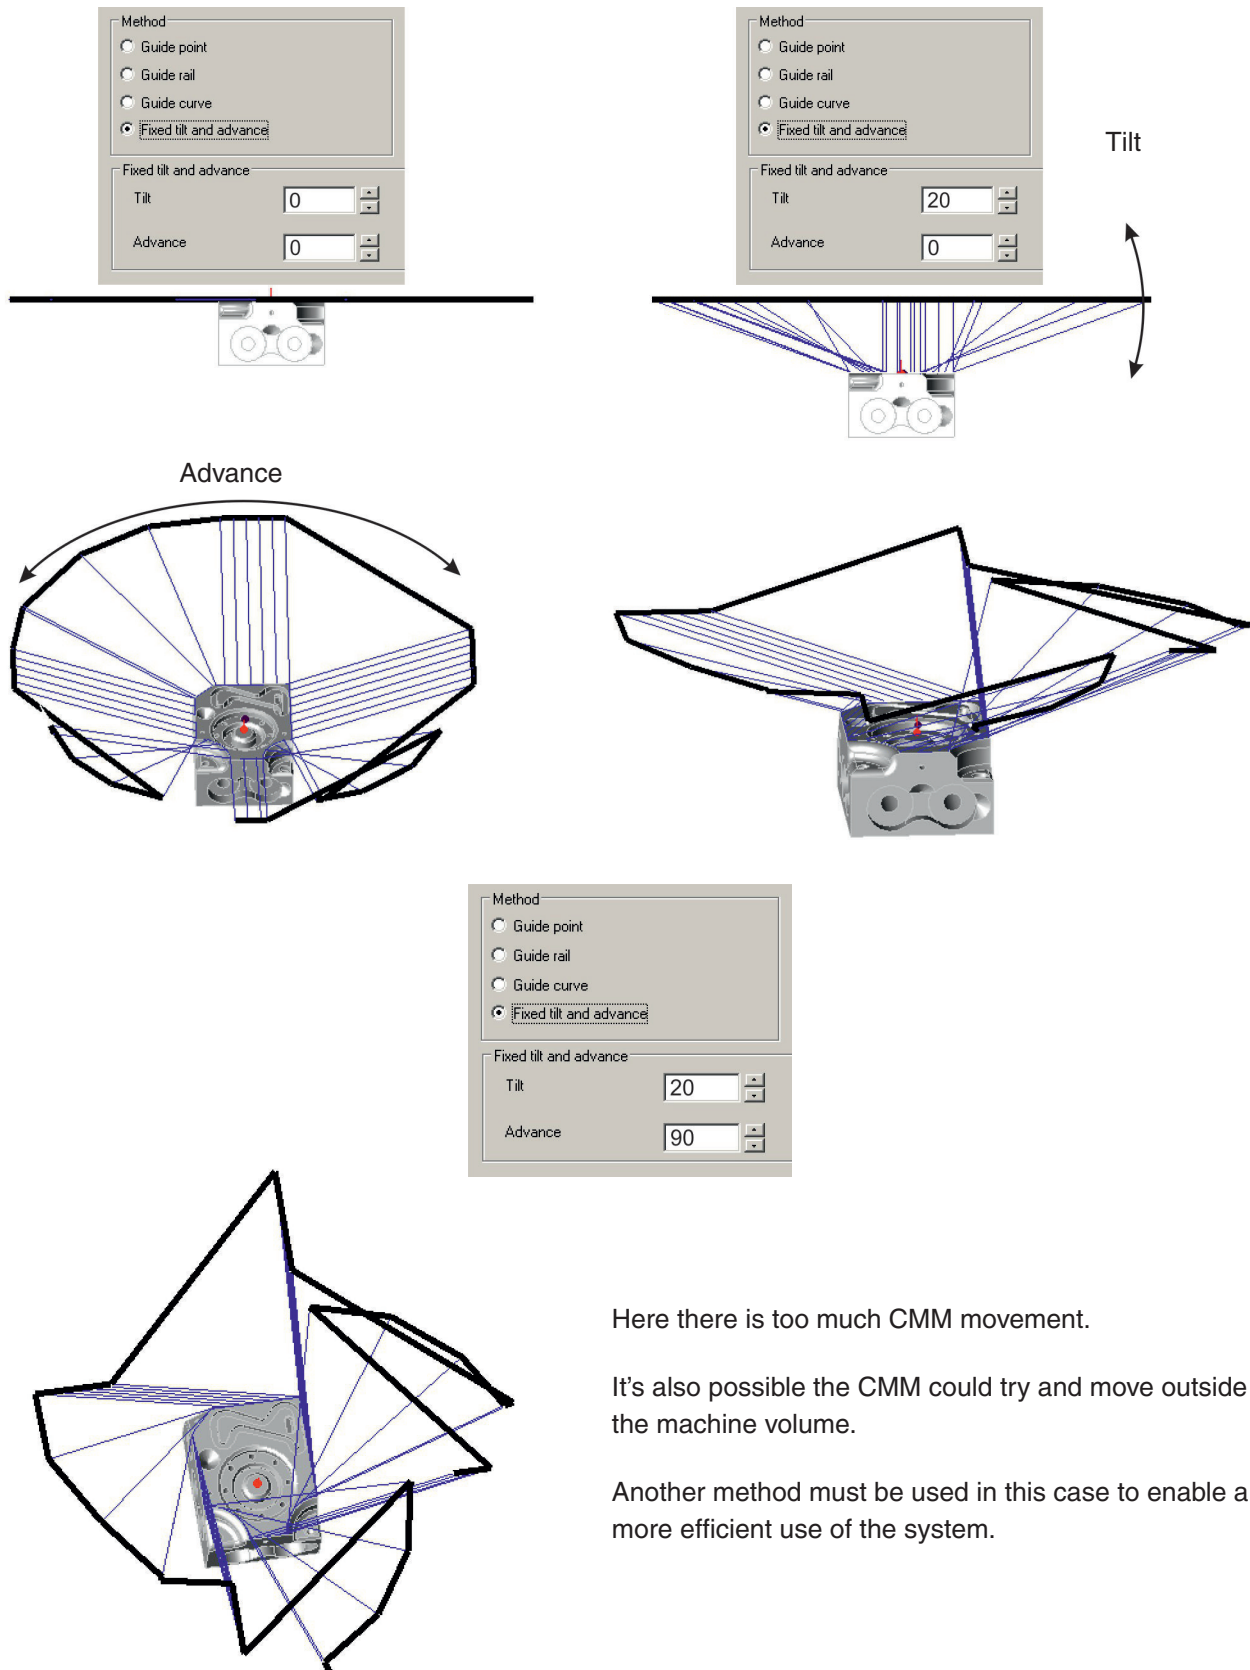

Fixed tilt and advance is useful when scanning a boss.


In this case the stylus is required to be offset at an angle to the boss face to avoid shanking.

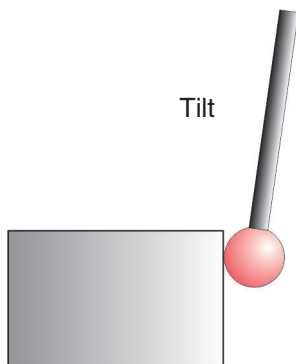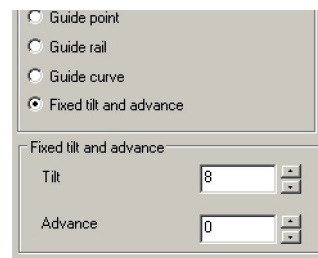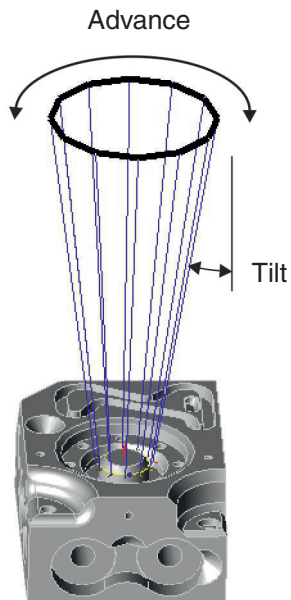

8 Create multiple plane scans within one measurement block

In certain cases more coverage / point collection is desired on a component.

In this case more than one path can be included within a single inspection block.

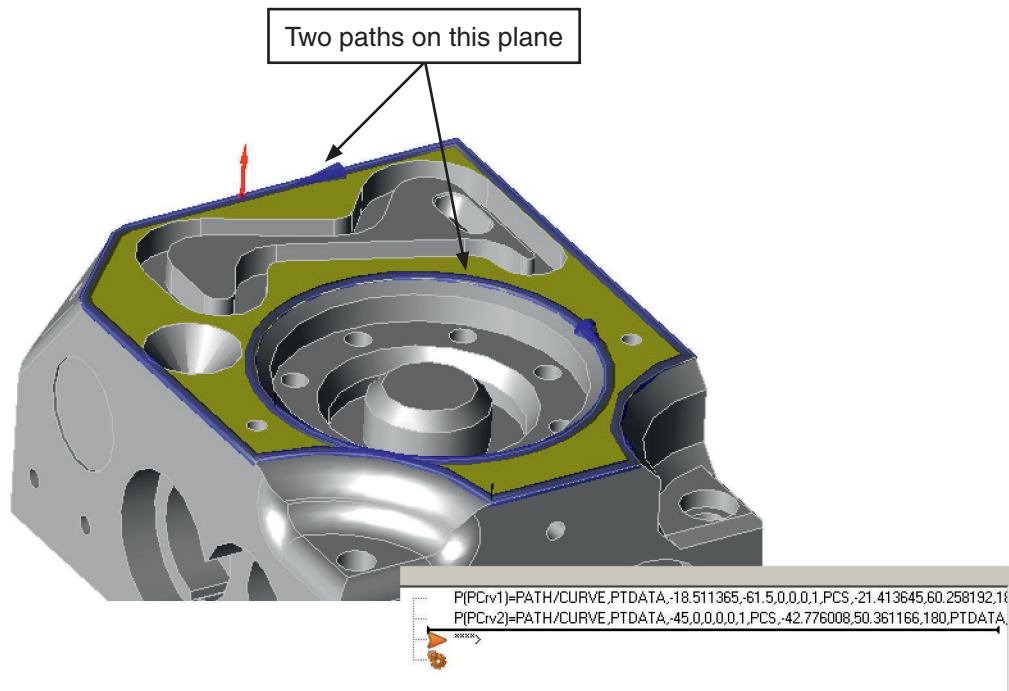

```
Inspect - Plane
Scan - Edge Offset
Select first curve - Ok
Adjust Tilt & Advance - Ok
First Path is created

Scan - Edge Offset
Select next curve - Ok
Adjust Tilt & Advance - Ok
Next Path is created

Apply to complete
```


Code produced:


```
P(PCrv1)=PATH/CURVE,PTDATA,-18.511365,-61.5,0,0,0,1,PCS,-21.413645,nnnn
P(PCrv2)=PATH/CURVE,PTDATA,-45,0,0,0,0,1,PCS,-42.776008,50.361166,180,nnnn

F(TOP_FACE)=FEAT/PLANE,CART,0,92.5,0,0,0,1
MEAS/PLANE,F(TOP_FACE),3
PAMEAS/DISTANCE,9.104,SCNVEL,MMPS,100,P(PCrv1),0,0,1
PAMEAS/DISTANCE,9.104,SCNVEL,MMPS,100,P(PCrv2),0,0,1
ENDMES
```

9 Manually define the scan path



In other cases the user can define their own path coverage using the mouse.

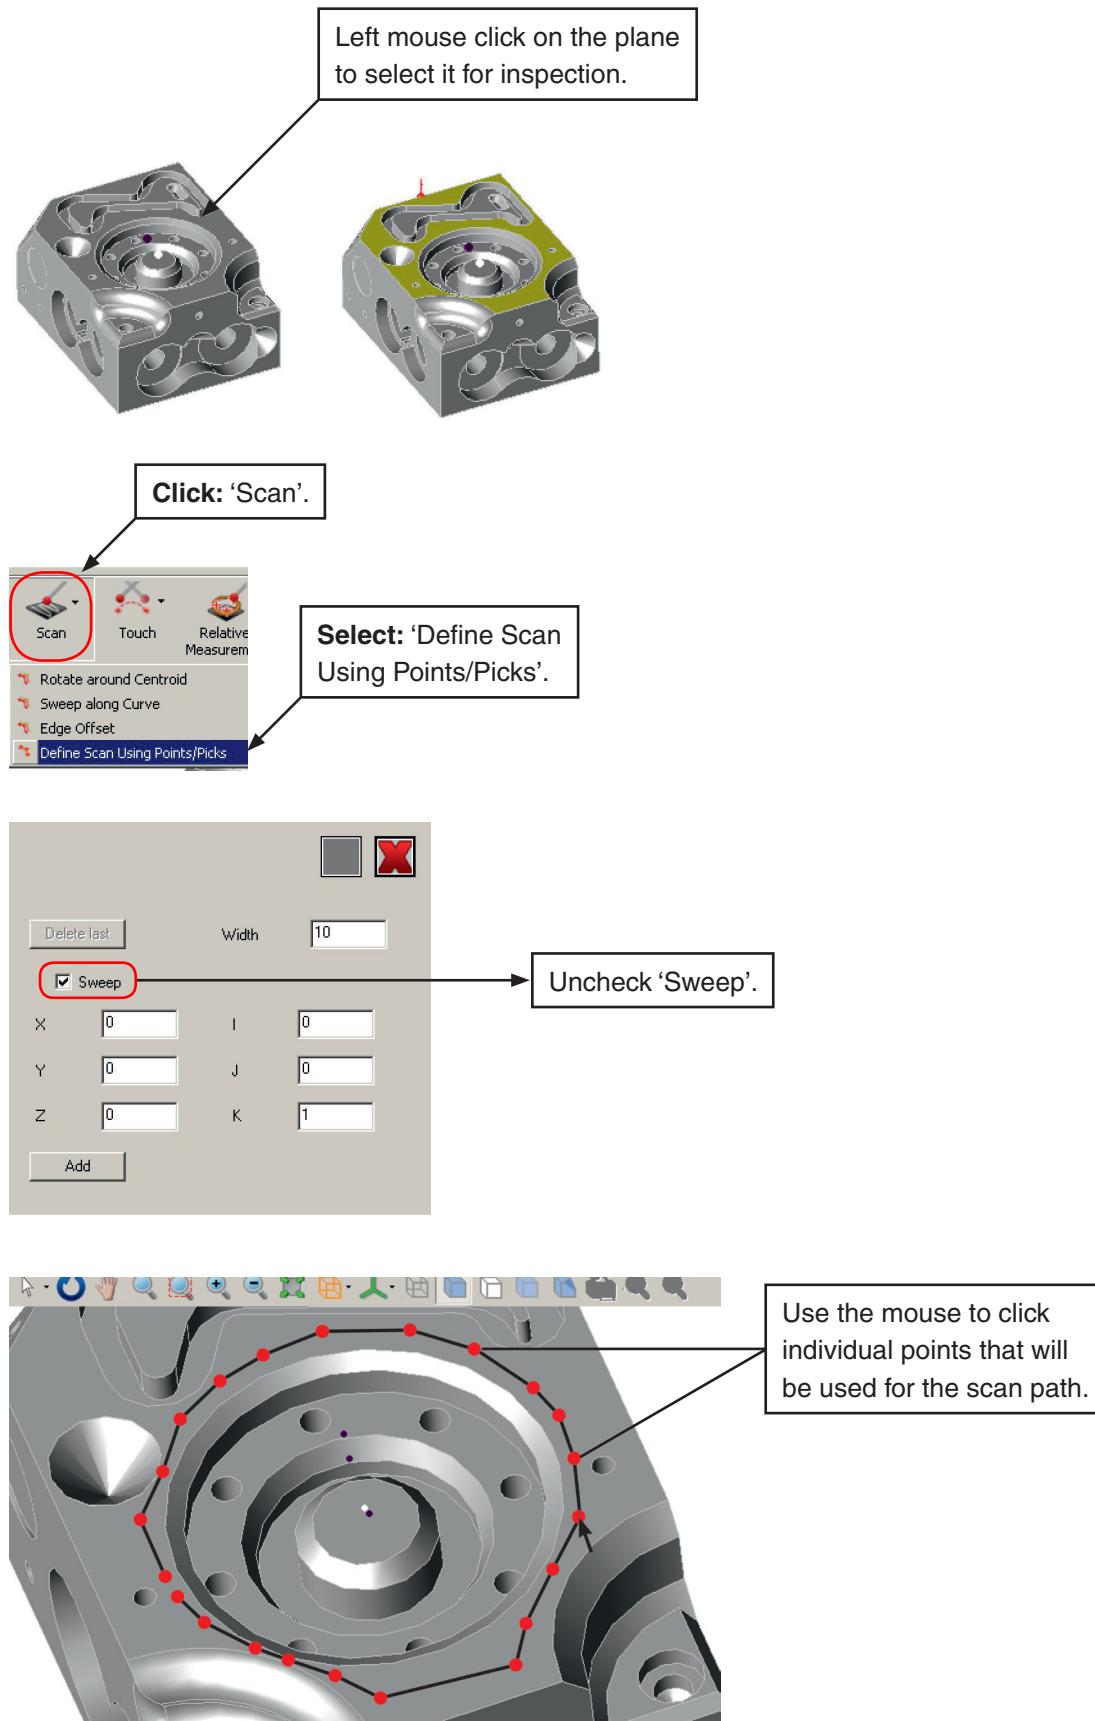

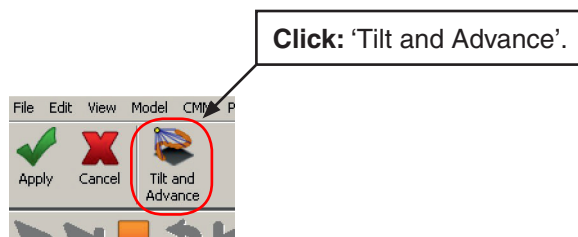

In this case guide point or guide rail is suitable.

GUIDANCE NOTE: Unlike 'Edge Offset' scan, the 'Tilt and Advance' dialogue box does not open automatically after selecting a scan path using points and picks.

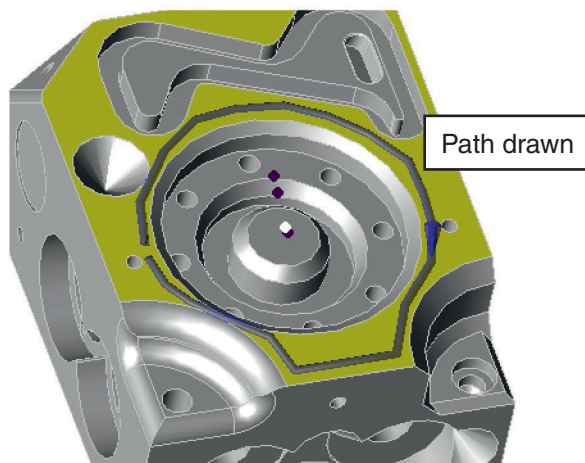
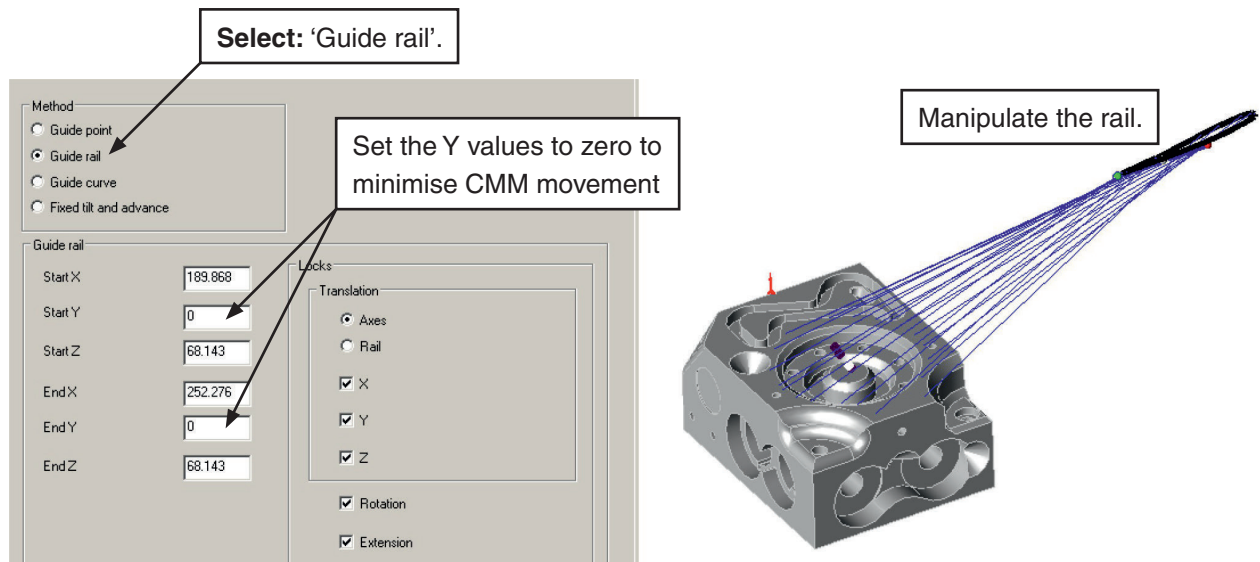


10 Using sweep method

Define the scan path on the model by picking successive points on the model, typing in different sweep widths between points where necessary.


Also, type in the XYZ and IJK values for successive points.

Click: 'Add' to add them to the model.

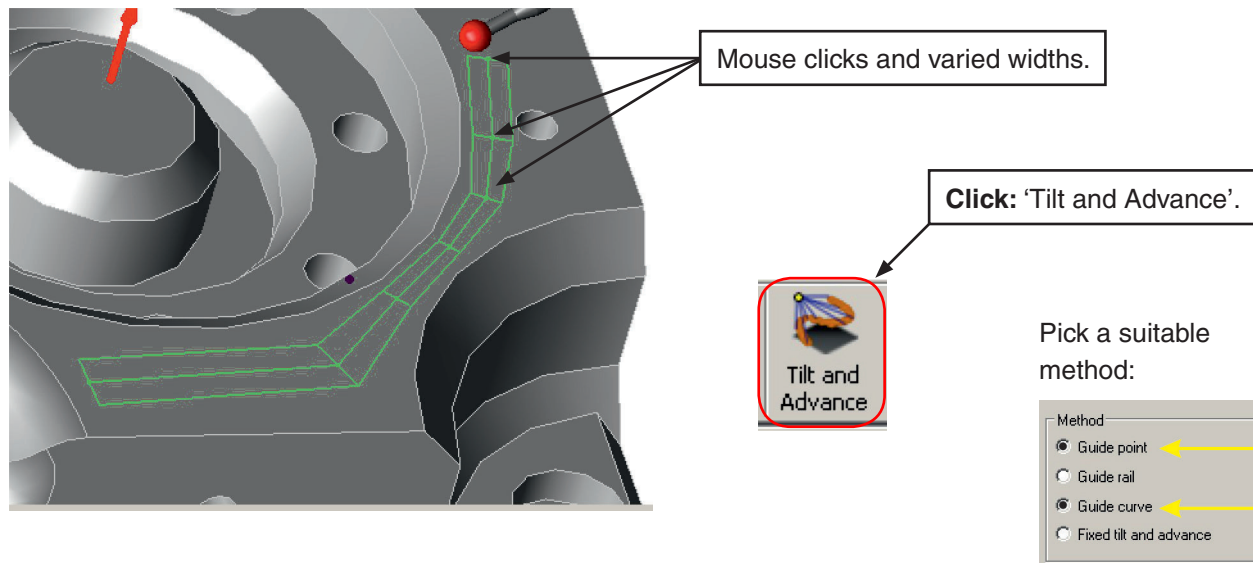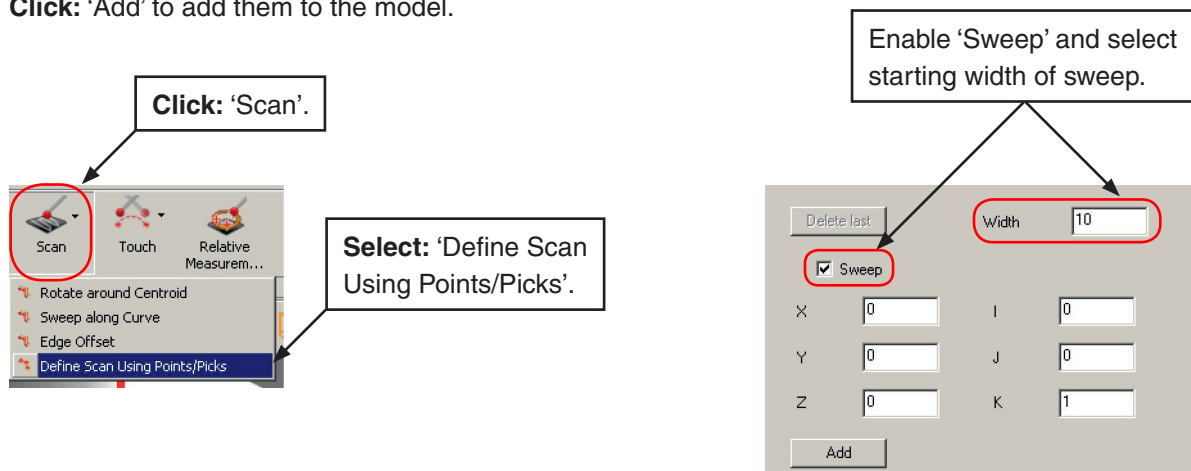


Method A

Manipulate guide curve to maximise probe and CMM efficiency.

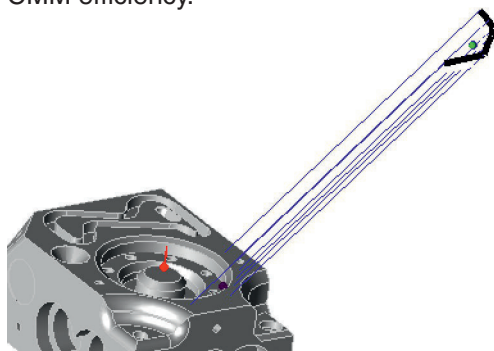

Method B

Manipulate guide point to maximise probe and CMM efficiency.

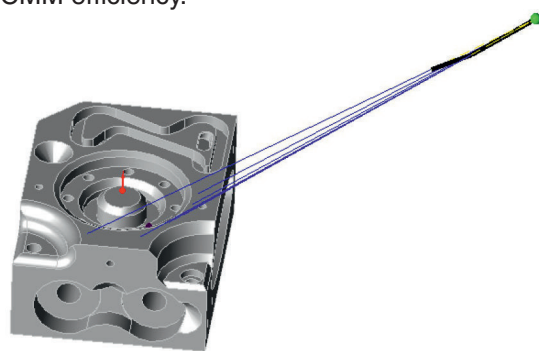

This page intentionally left blank

Renishaw plc
New Mills, Wotton-under-Edge,
Gloucestershire, GL12 8JR
United Kingdom

T +44 (0)1453 524524
F +44 (0)1453 524901
E uk@renishaw.com
www.renishaw.com

RENISHAW 
apply innovation™

**For worldwide contact details,
please visit our main web site at
www.renishaw.com/contact**



H - 1000 - 5327 - 01